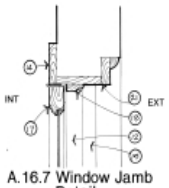

A.16.7 Window Jamb Detail 3":1'-0"

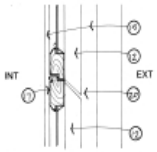

A.16.6 Meeting Stile Detail 3":1'-0"

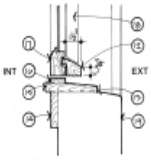

A.16.5 Window Sill 3":1'-0"

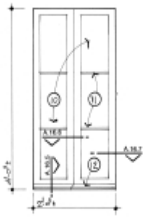

A.16.4 Window W3 1":1'-0"

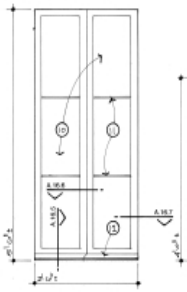

A.16.3 Window W2 1":1'-0"

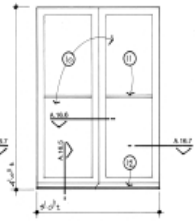

A.16.2 Window W1 1":1'-0"

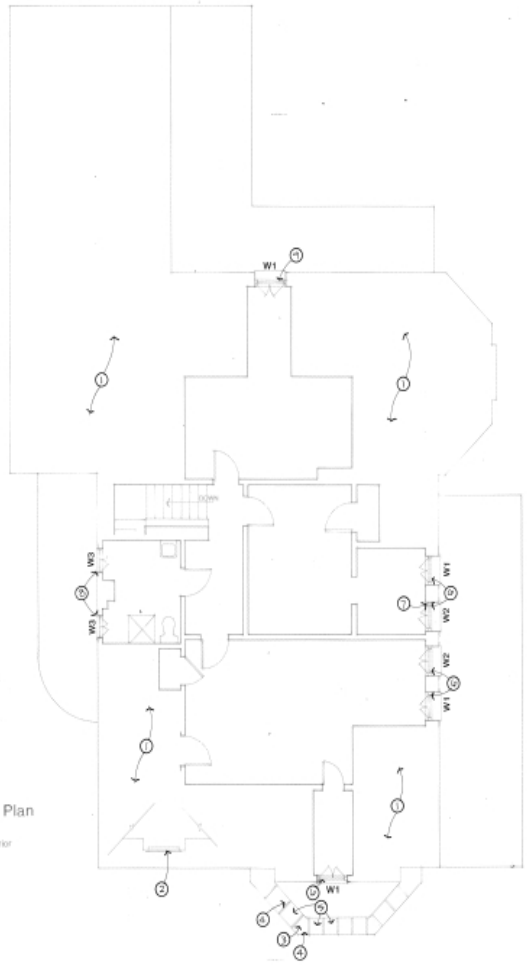

A.16.1
Third Floor Plan
1/4":1'
891 sf gross interior

Halff House
Third Floor

Bldg.# 308 139 Goliad
Ca. 1893

KEYNOTES

1. ATTIC
2. FIX LOUVER WITHIN EXISTING FRAME
3. REPLACE MISSING STONE / MATCH ADJACENT
4. PATCH DAMAGED STONE
5. RESET LOOSE STONE
6. REPLACE MISSING WOOD DRIP AT BOTTOM RAIL OF WINDOWS / SEE A.16.5
7. REPLACE WOOD SILL / SEE A.16.5 / ADJUST WINDOW WITHIN OPENING
8. REPLACE WINDOW, WOOD DRIP AND SILL / SEE A.16.4
9. REPLACE WINDOW, WOOD DRIP AND SILL / SEE A.16.2
10. NEW WINDOW HARDWARE / WINDOW LATCH ON ACTIVE LEAF / BARREL BOLT TOP AND BOTTOM ON INACTIVE LEAF / WEATHERSTRIPPING AROUND PERIMETER / (3) HINGES PER LEAF
11. HORIZONTAL MUNTIN
12. WOOD DRIP WITH 1/2" x 1/2" RABBET / GLUE AND NAIL INTO 1/2" x 1/2" DADO IN SASH / CONTINUOUS
13. SEALANT
14. EXISTING 1 x 4 TRIM
15. 1 x 6 WOOD SILL / SLOPE EXTERIOR TO DRAIN
16. 1/2" WATER STOP / SEAL TO SILL
17. WINDOW SASH / LAP MEETING STILES WITH BEAD PROFILE ON ACTIVE LEAF
18. EXTERIOR WOOD STOP WITH OGEE PROFILE / STOP ABOVE WOOD DRIP
19. EXISTING WALL
20. 45° DEGREE JOINT IN WOOD DRIP AT MEETING STILES
21. EXISTING WOOD FRAME

DRAWING NO. 90043

OCT 1991

HEMISFAIR PARK
HISTORIC STRUCTURES – PHASE II
CITY OF SAN ANTONIO

Rehler Vaughn
Beery & Koone, Inc.

architecture
interior architecture
landscape architecture
master planning

RVBK
ARCHITECTS

A.16