# Kampmann House

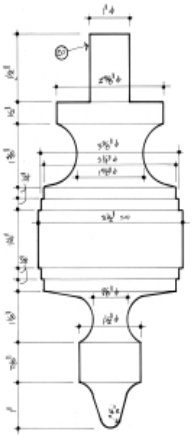

A.23.4 Turned Ornament
FULL SCALE

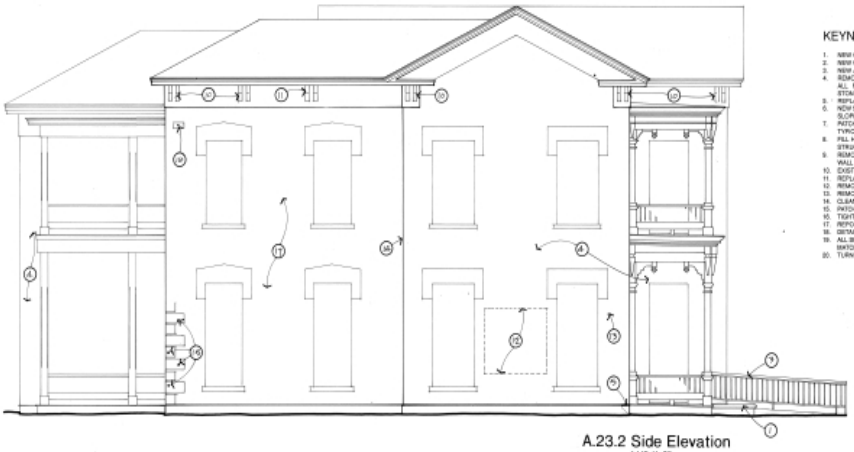

A.23.2 Side Elevation
1/4":1'-0"

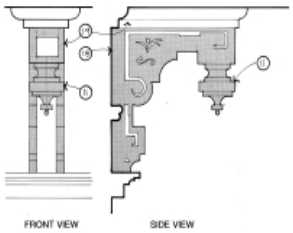


A.23.3 Typical Bracket
N.T.S.

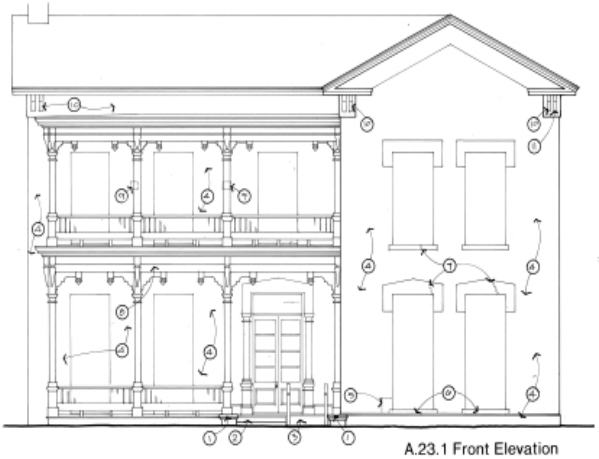

A.23.1 Front Elevation
1/4":1'-0"

## KEYNOTES

1. NEW CAST STONE CAP / SEE A.23.6
2. NEW CONCRETE STEPS / SEE A.43.1
3. NEW ACCESSIBLE RAMP / SEE SITE PLAN
4. REMOVE ALL PORTLAND CEMENT PLASTER / REPOINT ALL MASONRY / FORM BEAD JOINTS BETWEEN STONES IN A COURSED PATTERN
5. REPLACE SEVERELY DAMAGED STONE
6. NEW STONE SILL (APPROXIMATELY 0' x 0' x 4'-6" WITH SLOPED TOP)
7. PATCH CRACKS IN STONE SILLS AND LINTELS, TYPICAL
8. FILL HOLE IN STONE WALL (BEYOND PORCH ON MAIN STRUCTURE)
9. REMOVE ELECTRICAL BOX / FILL HOLE IN STONE WALL
10. EXISTING BRACKET / PAINT PER DETAIL A.23.2
11. REPLACE MISSING TURNED ORNAMENT / SEE A.23.4
12. REMOVE NAILS
13. REMOVE ANCHOR
14. CLEAN JOINT / INSTALL NEW SEALANT
15. PATCH DAMAGED GUIDING
16. TIGHTEN TIE ROD
17. REPOINT ALL BRICK, TYPICAL
18. DETAILS NOT SHOWN FOR CLARITY
19. ALL SHADED AREAS TO BE PAINTED LIGHT GREEN TO MATCH PORCH TRIM
20. TURNED DOWEL / GLUE INTO HOLE AT BRACKET

project no. DL

date OCT 1991

**HEMISFAIR PARK**
HISTORIC STRUCTURES – PHASE II
CITY OF SAN ANTONIO

Renier Vaughn Beasty & Koone, Inc.
architecture
interior architecture
landscape architecture
master planning

RVBK
ARCHITECTS
**A.23**