Kampmann House

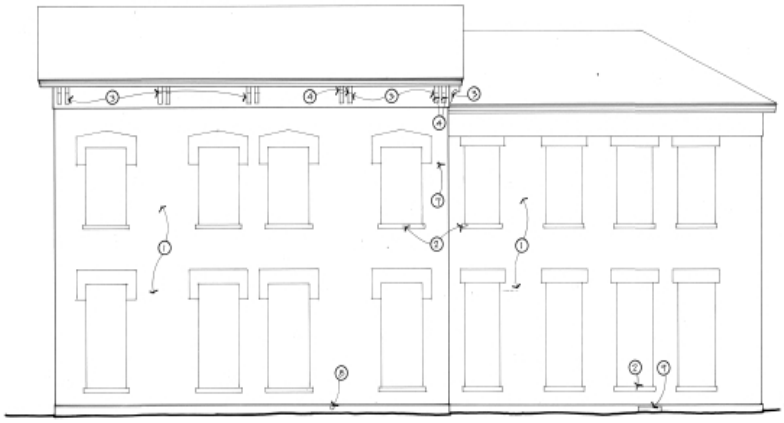

A.24.2 Side Elevation
1/4"=1'-0"

A.24.1 Rear Elevation
1/4"=1'-0"

KEYNOTES

1. REMOVE ALL PORTLAND CEMENT PLASTER / REPOINT ALL MASONRY / FORM BEAD JOINTS BETWEEN STONES IN A COURSED PATTERN
2. PATCH CRACKS IN STONE SILLS AND LINTELS, TYPICAL
3. EXISTING BRACKET / PAINT PER DETAIL A.23.3
4. REPLACE MISSING TURNED ORNAMENT / SEE A.23.4
5. PATCH DAMAGED QUOINS
6. REPOINT ALL BRICK TYPICAL
7. REMOVE WIRE / PATCH HOLE
8. FILL HOLE IN STONE WALL
9. INSTALL NEW EXPANDED METAL IN EXISTING FRAME

project no. 90L

date OCT 1991

HEMISFAIR PARK
HISTORIC STRUCTURES – PHASE II
CITY OF SAN ANTONIO

Ferrier Vaughn Beaty & Kocon, Inc.
architecture
interior architecture
landscape architecture
master planning

RVBK
ARCHITECTS

A.24